

PRODUCT RECALL

SUBJECT: [SAFETY] - PRODUCT RECALL - Inflatable lifejackets - PLASTIMO
SAFETY APPROACH

Customer's name : XXXXXXXXXXXXX

Card number : XXXXXXXXXXXXX



Dear customers,

We must inform you regarding this important safety warning, which concerns **ONLY PLASTIMO lifejackets equipped with Hammar Hydrostatic Inflator MA1 assembled with ISI CO2 cylinder including rearming Kits**. Despite rigorous quality control procedures, PLASTIMO has noticed a number of lifejackets which does not meet our company safety performance requirements nor the ISO 12402 standards: an inflation time above 5 sec time as required by the ISO std. The risk is a slow deployment of the vest which can lead to a risk of drowning.

If you purchased the following products from September 1st, 2021 to April 2022. inclusive, you are affected by this verification campaign:

Product's name : PILOT 165 ZIP and/or Re-arming kits MA1

Brand : PLASTIMO

model code : 8290714 / 8571488


All customers must have to stop using them. These must be returned for inspection where free appropriate replacement of the Hammar MA1 inflator and gas cylinder will be done by Plastimo or approved service station.

DO NOT USE YOUR LIFEJACKET

You should write directly to: gilets-Lifejackets2022@plastimo.com (Indicating the address for free delivery and inflator replacement).

3 options to identify the date of lifejackets may concerned:

- 1> See date on your purchase receipt (from September 1st, 2021 to April 2022)
- 2> See manufacturing date located inside the lifejacket cover (August =08: 2021 until 01/2022)
- 3> See manufacturing date indicated on the packaging (August =08: 2021 until 01/2022)

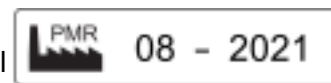

Lifejackets bought before September 2021 or after April 2022 or with other inflators systems are NOT affected by this Product Recall.

contact our customer relation center at customer.enquiries@decathlon.com or chat at decathlon.co.uk

We thank you for your understanding and apologize for any inconvenience caused.